

# TENNESSEE DEPARTMENT OF TRANSPORTATION EROSION PREVENTION/SEDIMENT CONTROL INSPECTION REPORT

TDOT EPSC INSPECTION FORM Rev. Feb 2010

10.31.11

Reason For Inspection:

2nd Weekly

											DATE: /o	.3/.1/
State Roule	(SR) / US Rou	ite or Road Na	ime and De	scription:			Are correcti	ve aclions	required by	this inspec	ction report (Y/N):	
		Wolf	River Blvd.					536	No			
County(ies):		TDOT PIN:		NPDES Per	rmil (NOC)	#:	Number of I	New	Number of	Recurring	Number of New	Number of Un-Corrected
SI	nelby	1016	tietz		NR153299		Corrective A		Corrective /		Sediment Releases	: Sediment Releases:
TDOT Cons	truction No.:	TDOT Contract	cl No.:	Contractor:								
7994-	1535-54			Acuff	Enterprises	s Inc.	0		. 0			
Lcertify unde	er penally of law	That this docume	ent and all a	Hachments w	vere	COG EBS	C Inchector	and Title (n	orint or type)		Signature:	
prepared und designed to a information p	ler my direction assure that quali resented. Base system, or those	or supervision ir fied personnel p d on my inquiry	n accordance roperly gath of the perso	e with a syste ered and eva n or persons	em alualed who	COG EPSI		ld "Jerry" S			Soral	Startel
information, I of erosion an above. I cert identified out	cerify that inspend and sediment cont lify that erosion a fall where install	ections of storm trols have been and sediment co ed as planned a	water discha performed a ontrols in the and designed	arge points (c s recorded in drainage are I in working c	outfalls), and I the table ea of the order as	Contractor		eclor and T Tom Acuff	ille (print or	lype):	Signature:	Cuff
recorded in the submitting faction knowing viole	he table above Ise information, ations	I am aware that including the po	there are signsibility of fire	gnificant pena ne and impre	allies for sonment for	COG EPS (print or ty		anager imothy Bier	rdz		Signature:	
		TDOT EPSC	Inspectio	n Weekly F	Rainfall Dat	a Log						
		Predicted	Rainfall	Rainfall	Rainfall	Rainfall	Rainfall	Rainfall			ntractor Agrees with	Inspection Report:
Dale	Day of Week		Gauge 1	Gauge 2	Gauge 3	Gauge 4	Gauge 5	Gauge 6	Duration	NO	or YES	
10.30.11	Sunday	(%)	(in)	(in)	(in) N/A	(in) N/A	(in) N/A	(in) N/A	(hr)	п мо, ехр	lain and initial:	
10.31.11	Monday	10	0	0	N/A	N/A	N/A	N/A	<u> </u>			
11.1.11	Tuesday	10			N/A	N/A	N/A	N/A			Marine Jennis, 10 - 1,000 m. 100 m	
11.2.11	Wednesday	0			N/A	N/A	N/A	N/A				
11.3.11	Thursday	30			N/A	N/A	N/A	N/A				
10.28.11	Friday	30	0.60	0.60	N/A	N/A	N/A	N/A	2 HR.			
10.29.11	Saturday	0			N/A	N/A	N/A	N/A				
	Sunday				N/A	N/A	N/A	N/A				
	Monday				N/A	N/A	N/A	N/A		1010/08/09/01/09/01/09/01/09/01/09/01/09/01/09/01/09/01/09/01/09/01/09/01/09/01/09/01/09/01/09/01/09/01/09/01		A parameter and a parameter an
		Predicted Pre	ecipitation S	Source		www.we	ealher.com			(Ac	Iditional pages may b	pe attached, if needed) Page 1 of 7

	i VI	HE ST	×.
TS.	ACRE	Ž	
NE NE	No Alex	*/	
16		96 * 3	

State/US	Route	or Road	Name:
----------	-------	---------	-------

Wolf River Blvd.

TDOT Construction No.: 79954-3537-54

		7-5	

TDOT Contract No.:

**CONDITION CODES** 

Date	10/31/2011	

Outfall Name or Station No.	Rain Gage No.	Approx. Station No. From / To	LT, RT or Centerline	Date Last Disturbed	Date of Stabilization and Code T = Temp. P = Perm.	Existing EPSC Control Measure Codes*	Current Condition Codes*	Corrective Action(s) or Comments
1	1	14+14	LT	10/31/2011		22,35	FM	Weekly cleaning will be required, until further notice.
1A	1	21+50	RT	10/31/2011		41	FM	Const. of RCBC Pedestrian Underpass in progress.
1B	1	22+00	RT	10/24/2011		41	FM	Backfilling RCBC in progress.
1C	1	21+00	LT	10/27/2011	T = 10-6-11	12,15,35,41	FM	Monitoring BMP's in place. Remove Floatables. See Photo.
2A	1	33+50	LT,CL	10/27/2011		12,15,16,24	FM	Monitoring BMP's in place.
2B	1	35+50	LT	10/31/2011		16,24	FM	Weekly cleaning for stream crossing required, until further notice.
3	1	34+50	LT	10/27/2011		16	FM	Monitoring BMP in place.
4	1	40+00	RT	10/27/2011	T = 10-24-11	15,16,43	FM	Temporary stabilize gap at new north slope. Monitoring BMP's in place. See Photo.
5A	1	49+00	RT	10/24/2011		16,33	FM	Monitoring BMP's in place.
5B	1	50+00	RT	10/24/2011		9,16,33	FM	Monitoring BMP's in place.

# **EROSION AND SEDIMENT CONTROL MEASURE CODES**

1	Temporary Silt Fence / Filter Barrier	15	Temporary seeding with Mulch	29	Excess Dirt Removed from Rdwy. Daily	М	Maintenance
2	Temporary Diversion Berm or Ditch	16	Temporary Mulch	30	Haul Roads Dampened for Dust Control	U	Upgrade Needed (Failure Noted)
3	Temporary Slope Drain	17	Erosion Control Blanket	31	Ditch Liner	R	Replacement Needed
4	Rock Check Dams	18	Flexible Channel Liner	32	Rock Silt Screen	FM	Future Maintenance
5	Brush Barrier	19	Catch Basin / Storm Inlet Protection	33	Temporary Silt Fence with Backing	С	Cleaning Needed
6	Sediment Removal	20	Riprap Outlet Structure	34	Enhanced Silt Fence	£.	Increase Measures
7	Straw Bale Check	21	Riprap Energy / Velocity Dissipater	35	Sediment Tube	W	Too Wet to Work Conditions
8	Sand Bags	22	Curb, Gutter, or Storm Sewer Protection	36	Sediment Dam	RO	Repeat Occurrence
9	Sediment Trap / Basin	23	Temporary at Construction Exit / Entrance	37	Concrete Washout, other pollution Issues	SR	Sediment Release
10	Temp Sediment Filter Bag / Dewatering	24	Temporary Stream Crossing	38	Berm (soil, riprap, rock)	FS	Final Stabilized
11	Polyethylene Sheeting	25	Turbidity Barrier / Silt Boom	39	Gabion	S	Stable (No Action Needed)
12	Machined Rip Rap	26	Temporary Stream Diversion	40	Sheet Pilling	Other (O31):	
13	Geotextile	27	Preserve Natural Resource / Buffer Zone	41	Haul Road	Other (O#2):	
14	Permanent Seeding with Mulch or Sod	28	Mineral Aggregate Base on Subgrade	42	Bridge Construction	Other (O#3):	
				43	Stream Realignment		*

State/US	Route or	Road	Nam

V	V	oli	R	ive	r E	lvd.
---	---	-----	---	-----	-----	------

TOOT	Canal	truction	AL-
1001	COHS	truction	INO.

79954	250	7 E

DOT Contract No.:	
-------------------	--

**CONDITION CODES** 

Outfall Name	Rain	Approx.	LT, RT or	Date Last	Date of Stabilization	Existing EPSC	Current	
or Station No.	Gage	Station No.	Centerline	Disturbed	and Code	Control	Condition	Corrective Action(s) or Comments
	No.	From / To		210(4,204	T = Temp.	Measure	Codes*	Corrective Action(s) of Comments
	45.01 0.000,002.555				P = Perm.	Codes*	00000	
								Weekly cleaning for stream crossing
								required. (BMP's incomplete @ New
5C	1	44+00	LT	10/31/2011		16,24,33	FM	Channel Realignment. See Photo)
	224		10 - 37 - 49 -					
6	1	56+00	LT	10/24/2011			FM	Pond has been drained. Currently Stable.
_								
7	1	60+00	RT	10/24/2011	-	16, 33	FM	Currently Stable, Monitoring BMP's.
	2							Weekly cleaning for stream crossing will be
8A	1	73+00	RT	10/31/2011		16,24,42	FM	required, until further notice.
8B	2	75+50	RT	9/29/2011		16,24,35,41	S	Currently Stable, Monitoring BMP's.
				0/20/2011		10,24,00,41		Currently Stable, Monitoring BIMP's.
8C	1	71+00	LT	10/31/2011		16,35,42	FM	Active construction zone. Monitoring BMP's.
B00000		ALCOHOL CONTRA	20 (432m344 20000 9000 20 (2000					Monitoring BMP's. Weekly watering required
8D	2	75+50	LT	10/3/2011	T = 10-3-11	16,35,42	FM	until seed establishes.
8E	1	71+50						
OE.	1	7 1+50	LT		-			The area has not been disturbed.
	_		22722					ATTIME CORNER BOT BY TO BE TOUR TO APPROVE
9A	2	80+00	RT	9/29//11	T = 10-3-11	6,15,33,35	FM	Weekly watering required until seed establishes.
9B	2	80+00	LT	9/29//11	T = 10-3-11	15,16,17,,35	FM	Weekly watering required until seed establishes.

# **EROSION AND SEDIMENT CONTROL MEASURE CODES**

### Temporary Silt Fence / Filter Barrier Temporary Seeding with Mulch Excess Dirt Removed from Rdwy, Daily Maintenance Temporary Diversion Berm or Ditch 2 Temporary Mulch 30 Haul Roads Dampened for Dust Control U Upgrade Needed (Failure Noted) 3 Temporary Slope Drain 17 Erosion Control Blanket 31 Ditch Liner Replacement Needed 4 Rock Check Dams 18 Flexible Channel Liner 32 Rock Silt Screen FM Future Maintenance 5 **Brush Barrier** 19 Catch Basin / Storm Inlet Protection 33 Temporary Silt Fence with Backing C Cleaning Needed 6 Sediment Removal 20 Riprap Outlet Structure Enhanced Silt Fence 34 Increase Measures Straw Bale Check Riprap Energy / Velocity Dissipater 35 Sediment Tube W Too Wet to Work Conditions 8 Sand Bags 22 Curb, Gutter, or Storm Sewer Protection 36 Sediment Dam RO Repeat Occurrence 9 Sediment Trap / Basin 23 Temporary at Construction Exit / Entrance 37 Concrete Washout, other pollution Issues SR Sediment Release Temp Sediment Filter Bag / Dewatering 10 24 Temporary Stream Crossing Berm (soil, riprap, rock) 38 FS Final Stabilized Polyethylene Sheeting 11 25 Turbidity Barrier / Silt Boom 39 Gabion S Stable (No Action Needed) 12 Machined Rip Rap 26 Temporary Stream Diversion 40 Sheet Pilling Other (O31): 13 Geotextile 27 Preserve Natural Resource / Buffer Zone 41 Haul Road Other (O#2): 14 Permanent Seeding with Mulch or Sod Mineral Aggregate Base on Subgrade **Bridge Construction** Other (O#3):

State/US	Route o	r Road	Name

Wolf River Blvd.

TDOT Construction No.:

79954-3537-54

TDOT Contract No.:

Date

10/31/2011

Outfall Name or Station No.	Rain Gage No.	Approx. Station No. From / To	LT, RT or Centerline	Date Last Disturbed	Date of Stabilization and Code T = Temp. P = Perm.	Existing EPSC Control Measure Codes*	Current Condition Codes*	Corrective Action(s) or Comments
9C	2	79+50	LT	9/29/2011	T = 10-03-11	15,16,20,33	FM	Weekly watering required until seed establishes.
10A	2	85+00	RT	9/29/2011		15,16,35,41	FM	Currently active construction site. Sand bag upstream, remove daily during construction.
10B	2	85+00	RT	9/29/2011		15,16,35,41	FM	No work done in this area on inspection date.
10C	2	85+50	LT	9/29/2011		15,16,35,41	FM	No work done in this area on inspection date.
10D	2	84+50	LT	9/29/2011		15,16,35,41	FM	No work done in this area on inspection date.
11A	2	92+50	RT	10/31/2011		35,41	FM	Backfilling RCBC in progress.
11B	2	92+50	LT	10/6/2011		10,32,35,41	W	Remove floatables. See photo
11C	2	92+00	LT	10/6/2011		10,32,35,41	W	Remove floatables. See photo
	1	11+28	LT	10/31/2011		19,35	FM	Daily cleaning is required, until further notice
	1	13+40	RT	10/31/2011		23,29,30	FM	Daily cleaning will be required, until further notice.
100000000000000000000000000000000000000	1	107+75	CL	10/31/2011	MEASURE CODES	23,29,30	FM	Daily cleaning will be required, until further notice.

41

Haul Road

**Bridge Construction** 

### EROSION AND SEDIMENT CONTROL MEASURE CODES

Temporary Stream Diversion

Preserve Natural Resource / Buffer Zone

Mineral Aggregate Base on Subgrade

### Temporary Silt Fence / Filter Barrier Temporary Seeding with Mulch 15 1 2 Temporary Diversion Berm or Ditch 16 Temporary Mulch Temporary Slope Drain 3 17 **Erosion Control Blanket** 4 Rock Check Dams 18 Flexible Channel Liner 5 Brush Barrier 19 Catch Basin / Storm Inlet Protection 6 Sediment Removal 20 Riprap Outlet Structure Straw Bale Check 7 21 Riprap Energy / Velocity Dissipater 8 Sand Bags 22 Curb, Gutter, or Storm Sewer Protection 9 Sediment Trap / Basin 23 Temporary at Construction Exit / Entrance 10 Temp Sediment Filter Bag / Dewatering 24 Temporary Stream Crossing 11 Polyethylene Sheeting 25 Turbidity Barrier / Silt Boom

26

27

28

### 29 Excess Dirt Removed from Rdwy. Daily 30 Haul Roads Dampened for Dust Control 31 Ditch Liner 32 Rock Silt Screen 33 Temporary Silt Fence with Backing 34 Enhanced Silt Fence 35 Sediment Tube 36 Sediment Dam 37 Concrete Washout, other pollution Issues 38 Berm (soil, riprap, rock) 39 Gabion Stable (No Action Needed) 40 Sheet Pilling Oth

	CONDITION CODES
M	Maintenance
U	Upgrade Needed (Failure Noted)
R	Replacement Needed
FM	Future Maintenance
С	Cleaning Needed
I	Increase Measures
W	Too Wet to Work Conditions
RO	Repeat Occurrence
SR	Sediment Release
FS	Final Stabilized

Other (O31):		
Other (O#2):	10 38 30	
Other (O#3):		

12

13

14

Machined Rip Rap

Permanent Seeding with Mulch or Sod

Geotextile

	State/US Route
	Oldic/OO Nouli
<b>)</b>	

State/US Route or Road Name:	Wolf River Blvd.	TDOT Construction No.:	79954-3537-54	TDOT Contract No.:
				The state of the s

Date 10/31/2011

P									
Outfall Name	Rain	Approx.	LT, RT or	Date Last	Date of Stabilization	Existing EPSC	Current		
or Station No.	Gage	Station No.	Centerline	Date Last	and Code	Control	Current Condition	Corrective Action(s) or Comments	
*(Existing	No.	From / To	Centenne	Disturbed		Measure	Codes*	Corrective Action(s) or Comments	
	140.	110111710	1		T = Temp.		Codes		
Structure)					P = Perm.	Codes*	~~~	B 11 1 1 11 11 1 1 1 1 1 1 1 1 1 1 1 1	
* 109+51	2	East side of WRB	RT	10/31/2011		19,22	FM	Daily cleaning will be required, until further notice.	
		South side of		10/01/2011		10,22	1.00	Daily cleaning will be required, until further	
* 109+11	2	Farmington	RT	10/31/2011		19,22	FM	notice.	
100111		North side of	101	10/01/2011		10,22	1 101	Daily cleaning will be required, until further	
* 12+80	1	WRB	LT	10/31/2011		19,22	FM	notice.	
12.00			L I	10/31/2011		13,22	LIVI	nouce.	
		Walking Trail	. —			2002	<u> </u>		
	1	36+00	LT	7/20/2011	T = 7-20-11	5,35	S	Currently stable, Monitoring BMP's	
	1	Sta. 29+50 Slope	LT	7/20/2011	T= 9-01-11	16	s	Currently stable.	
				772072011	1 0 01 11	10			
		Sta. 13+40 -						Haul roads dampened frequently for dust	
		Sta. 107+75	LT, RT or CL	10/13/2011		30	FM	control, until further notice.	
	2	76+50 - 103+46	RT	9/29/2011	T = 10-03-11	15,16,35	   FM	Modely watering required until and established	
		70.00 100140	101	3/23/2011	1 - 10-03-11	10,10,55	1 171	Weekly watering required until seed establishes.	
71.07	2	92+50 - 107+00	LT	9/29/2011	T = 10-03-11	15,16,35	FM	Weekly watering required until seed establishes.	
					ALAND A SEC		1 200	Daily cleaning will be required, until further	
	1	6+75	LT	10/31/2011		19,22	FM	notice.	
	1	27+00	RT	10/3/2011	T= 10-03-11	15,16	s	Currently stable, Monitoring BMP's	
	1	34+00	RT	8/25/2011	T= 8-25-11	16	S	Currently stable, Monitoring BMP's	
	EROSION AND SEDIMENT CONTROL MEASURE CODES CONDITION CODES								

## EROSION AND SEDIMENT CONTROL MEASURE CODES

#### Temporary Silt Fence / Filter Barrier Temporary Seeding with Mulch Excess Dirt Removed from Rdwy, Daily M Maintenance 2 Temporary Diversion Berm or Ditch 16 Temporary Mulch 30 Haul Roads Dampened for Dust Control U Upgrade Needed (Failure Noted) 3 Temporary Slope Drain 17 Erosion Control Blanket 31 Ditch Liner R Replacement Needed 4 Rock Check Dams 18 Flexible Channel Liner 32 Rock Silt Screen FM **Future Maintenance** 5 Brush Barrier 19 Catch Basin / Storm Inlet Protection Temporary Silt Fence with Backing 33 Cleaning Needed 6 Sediment Removal 20 Riprap Outlet Structure 34 Enhanced Silt Fence Increase Measures 7 Straw Bale Check 21 Riprap Energy / Velocity Dissipater 35 Sediment Tube W Too Wet to Work Conditions 8 Sand Bags 22 Curb, Gutter, or Storm Sewer Protection 36 Sediment Dam RO Repeat Occurrence 9 Sediment Trap / Basin 23 Temporary at Construction Exit / Entrance 37 Concrete Washout, other pollution Issues SR Sediment Release 10 Temp Sediment Filter Bag / Dewatering Temporary Stream Crossing 38 24 Berm (soil, riprap, rock) Final Stabilized FS Polyethylene Sheeting 25 11 Turbidity Barrier / Silt Boom 39 Gabion S Stable (No Action Needed) Machined Rip Rap 12 26 40 Temporary Stream Diversion Sheet Pilling Other (O31): Other (O#2): Geotextile 27 13 Preserve Natural Resource / Buffer Zone 41 Haul Road 14 Permanent Seeding with Mulch or Sod 28 Mineral Aggregate Base on Subgrade Bridge Construction Other (O#3):

**EPSC Inspection** 

.,;	OF THE S	<b>**</b> .
	GRICUIT	Z
	1796	

0 td Name:	Wolf River Blvd.	TDOT Construction No.:	79954-3537-54	TDOT Contract No.:

Date \_\_\_\_\_10/31/2011

Outfall Name or Station No.	Rain Gage No.	Approx. Station No. From / To	LT, RT or Centerline	Date Last Disturbed	Date of Stabilization and Code T = Temp. P = Perm.	Existing EPSC Control Measure Codes*	Current Condition Codes*	Corrective Action(s) or Comments
	1	21+33 - 26+00	LT	10/10/2011	T = 10-6-11	15,16,35,41	FM	Weekly watering required until seed establishes.
	1	21+33 - 26+00	RT	10/10/2011	T = 10-6-11	15,16,35,41	FM	Weekly watering required until seed establishes.
	1	25+00	LT	9/29/2011	T = 10-6-11	15,16,33,35,41	FM	Currently stable, monitoring BMP's.
	1	25+00	RT	9/29/2011	T = 10-6-11	15,16,33,35,41	FM	Currently stable, monitoring BMP's.
	1	27+50	RT	10/6/2011	T = 10-6-11	15,16,33,35,41	FM	Currently stable, monitoring BMP's.
	1	31+90	RT	9/29/2011	T = 10-6-11	15,16,35	FM	Currently stable, monitoring BMP's.
	1	15+60	RT	9/15/2011	T = 10-6-11	15,16,33,35	FM	Currently stable, monitoring BMP's. Weekly watering required until seed establishes.
* 108+37		North side of WRB	LT	10/31/2011		19,22	FM	Daily cleaning will be required, until further notice.
	1	23+00 - 26+00	RT	9/29/2011	T = 10-6-11	33,41	FM	Currently stable, monitoring BMP's.

#### **EROSION AND SEDIMENT CONTROL MEASURE CODES CONDITION CODES** Temporary Silt Fence / Filter Barrier Temporary Seeding with Mulch Excess Dirt Removed from Rdwy. Daily M Maintenance 2 Temporary Diversion Berm or Ditch 16 Temporary Mulch 30 Haul Roads Dampened for Dust Control U Upgrade Needed (Failure Noted) 3 Temporary Slope Drain 17 Erosion Control Blanket 31 Ditch Liner Replacement Needed 4 Rock Check Dams 18 Flexible Channel Liner 32 Rock Silt Screen FM **Future Maintenance** 5 Brush Barrier 19 Catch Basin / Storm Inlet Protection Temporary Silt Fence with Backing C Cleaning Needed 6 Sediment Removal Riprap Outlet Structure **Enhanced Silt Fence** 20 34 Increase Measures 7 Straw Bale Check Riprap Energy / Velocity Dissipater W 21 35 Sediment Tube Too Wet to Work Conditions 8 Sand Bags 22 Curb, Gutter, or Storm Sewer Protection 36 Sediment Dam RO Repeat Occurrence 9 Sediment Trap / Basin 23 Temporary at Construction Exit / Entrance 37 Concrete Washout, other pollution Issues SR Sediment Release Temp Sediment Filter Bag / Dewatering 10 Temporary Stream Crossing 24 38 Berm (soil, riprap, rock) Final Stabilized 11 Polyethylene Sheeting 25 Turbidity Barrier / Silt Boom 39 S Stable (No Action Needed) Gabion 12 Machined Rip Rap 26 Temporary Stream Diversion 40 Sheet Pilling Other (O31): 13 Geotextile 27 Preserve Natural Resource / Buffer Zone Other (O#2): 41 Haul Road

42

**Bridge Construction** 


Permanent Seeding with Mulch or Sod


28

Mineral Aggregate Base on Sub grade

14

Other (O#3):

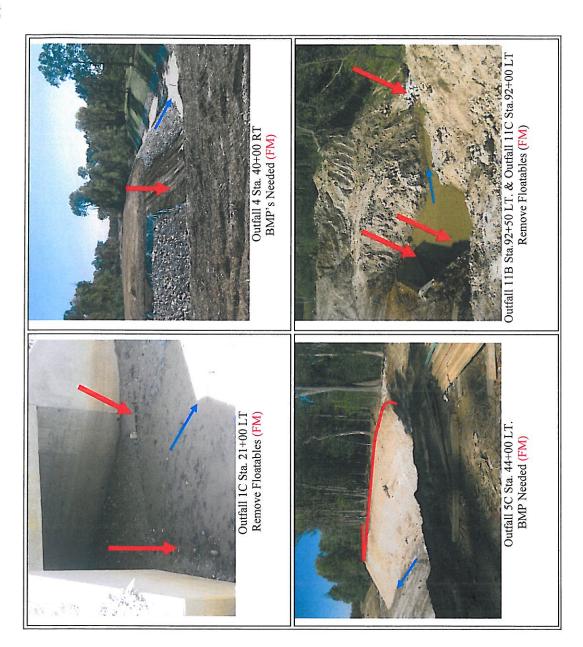

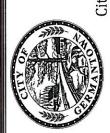

City of Germantown 1920 S. Germantown Road Germantown, TN 38138